
High Performance, Microminiature Circular Connectors


HR25 Series



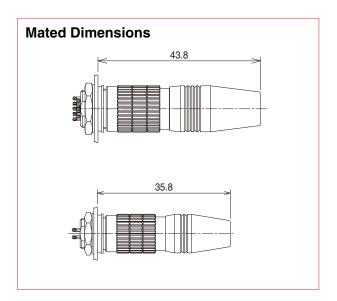

Crimp type jack (HR25-9TJ-**C)

■Diagrams of Connectors in Combination

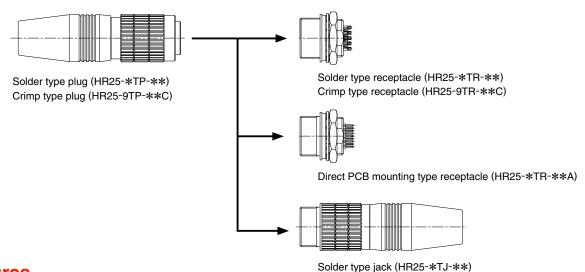

■Features

1. Small, High Density Design

Maximum plug outer diameter : 4, 6, 8 contacts : ϕ 10.5

12, 16, 20 contacts : ϕ 12.5

Designed with Hirose technology to be small, compact connectors with a low profile.

2. Wide Range of Product Variations

Number of contacts: 4, 6, 8, 12, 16, 20 Connector styles : Plug, jack, receptacle

Termination style : Solder, crimp (Additionally, a direct PCB mounting style is also available for receptacles.)
Contact gender : Plug, receptacle, and jack connectors are available configured either way with male

or female contacts.

3. Shielded Design

The connector's metal shell design is an optimal choice for devices that require EMI shielding.

4. RoHS Compliant

All materials and substances used to produce this product comply with RoHS standards.

5. High Speed Transmission

Supports Cat.5e(1Gbps) high speed Ethernet

*Based on EtoE standard Class D3-Conn E3.

*Characteristics are affected by the pin assignment, cable specifications and cable assembly conditions, so please confirm before use.

*Please contact a Hirose representative for the recommended pin assignment.

■Product Specifications

		•			
Dation		Rated current	1A	Operating temperature range	-25℃ to +85℃
Rating	S	Rated voltage	30V AC, 42V DC	Storage temperature range	-10℃ to +60℃

Items	Specifications	Conditions
1.Contact resistance	30mΩ min.	Measured at DC 1A
2.Insulation resistance	1,000MΩ min.	Measured at DC 100V
3.Withstanding Voltage	No flashover or dielectric breakdown.	AC 100V for one minute
4.Vibration resistance	No electrical discontinuity for $10\mu s$ or greater.	10 to 55 Hz/cycle, amplitude : 0.75mm, 3 axis directions, 2 hours each direction
5.Shock resistance	No electrical discontinuity for $10\mu s$ or greater.	Acceleration: 490ms², duration: 11ms, 3 axis directions, 3 cycles each direction.
6.Mating Cycles	Contact resistance : $50m\Omega$ max.	1,000 times
7.Temperature cycle	Insulation resistance : 1,000MΩ min.	-55°C: 30 minutes → Normal temperature: 10 to 15 minutes →85°C: 30 minutes → Normal temperature: 10 to 15 minutes, left for 5 cycles
8.Moisture resistance	Insulation resistance : $5M\Omega$ min. (at high humidity) $50M\Omega$ min (when dry)	Temperature : 40°C, relative humidity : 90 to 95%, left for 96 hours

■ Material

Ite	em	Material	Finish	Remarks
	Plated shell	Zinc alloy	Nickel plated	
	Insulator	PPS resin		UL94V-0
Plug/jack	Gasket, boot	Ethylene-propylene rubber		
	Contact	Phosphor bronze	Gold plated	
	Plated shell	Zinc ally	Nickel plated	
	Insulator	PPS resin		UL94V-0
Receptacle	Contact	Phosphor bronze	Gold plated	
	Gasket	Ethylene-propylene rubber		

■Product Number Structure

 $\frac{\mathsf{HR25}}{\bullet} - \frac{9}{2} \frac{\mathsf{T}}{\bullet} \frac{\mathsf{P}}{\bullet} - \frac{20}{6} \frac{\mathsf{P}}{\bullet} \frac{\mathsf{C}}{\bullet} \frac{(**)}{\bullet}$


- 1 Model name: HR25 Series
- 2Shell size: The shell size is the outer diameter of the mating end of the plug
- **18** Locking mechanism
 - T: Screw-lock
- 4 Connector type
 - P: Plug
 - R: Receptacle
 - J:Jack
- 6 Number of contacts
- 6 Contact type:
 - S: Female contact
 - P: Male contact
- Contact termination method:

None: Solder termination

- C: Crimp termination
- A: PCB dip termination
- 30 Other specifications: A two-digit number is added to indicate other specifications than 10 to 70 shown above.

■Plug





Solder type

Unit: mm

• · · · · · · · · · · · · · · · · · · ·							
Part No.	HRS No.	No. of contacts	Α	<i>φ</i> Β	φC	ϕ D	Weight
HR25-7TP-4P(72)	125-0001-8 72	4					
HR25-7TP-4S(72)	125-0002-0 72	4					
HR25-7TP-6P(72)	125-0003-3 72	6	25	10.5	6.7	5	0.0
HR25-7TP-6S(72)	125-0004-6 72		35				8g
HR25-7TP-8P(72)	125-0005-9 72	8					
HR25-7TP-8S(72)	125-0006-1 72	0					
HR25-9TP-12P(72)	125-0101-2 72	12					
HR25-9TP-12S(72)	125-0102-5 72	12			2.5 8.7		
HR25-9TP-16P(74)	125-0103-8 74	16	43	10.5		7	13g
HR25-9TP-16S(73)	125-0104-0 73	10	43	12.5			139
HR25-9TP-20P(72)	125-0105-3 72	20					
HR25-9TP-20S(73)	125-0106-6 73	20					


Crimp type

Unit: mm

- 171							
Part No.	HRS No.	No. of contacts	Α	<i>∲</i> B	φC	φD	Weight
HR25-9TP-12PC(72)	125-0401-6 72	12					
HR25-9TP-12SC(72)	125-0402-9 72	12					
HR25-9TP-16PC(72)	125-0403-1 72	16	43	12.5	8.7	7	100
HR25-9TP-16SC(72)	125-0404-4 72	10	43	12.5	0.7	/	12g
HR25-9TP-20PC(72)	125-0405-7 72	20					
HR25-9TP-20SC(72)	125-0406-0 72	20					

■ Receptacle



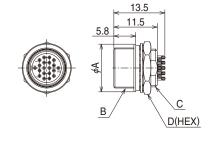

Solder type


Unit: mm

• · · · · · · · · · · · · · · · · · · ·							
Part No.	HRS No.	No. of contacts	φA	В	С	D	Weight
HR25-7TR-4S(73)	125-0007-4 73	4				5 10	
HR25-7TR-4P(73)	125-0008-7 73	4					
HR25-7TR-6S(73)	125-0009-0 73	6	10.6	M8.5×0.5	MOVOE		2~
HR25-7TR-6P(73)	125-0010-9 73	0	10.6	C.UXC.OIVI	M8×0.5		3g
HR25-7TR-8S(73)	125-0011-1 73	8					
HR25-7TR-8P(73)	125-0012-4 73	0					
HR25-9TR-12S(71)	125-0107-9 71	12					
HR25-9TR-12P(71)	125-0108-1 71	12					
HR25-9TR-16S(71)	125-0109-4 71	16	12.6	M10.5×0.5	M10×0.75	10	10
HR25-9TR-16P(71)	125-0110-3 71	16	12.0	WITU.SXU.S	WITUXU.75	12	4g
HR25-9TR-20S(71)	125-0111-6 71						
HR25-9TR-20P(71)	125-0112-9 71	20					

Crimp type

Unit: mm


• omin typo				Office filling
Part No.	HRS No.	No. of contacts	Α	Weight
HR25-9TR-12SC(71)	125-0407-2 71	12	11.5	
HR25-9TR-12PC(71)	125-0408-5 71	12	13	
HR25-9TR-16SC(71)	125-0409-8 71	16	11.5	20
HR25-9TR-16PC(71)	125-0410-7 71	10	13	3g
HR25-9TR-20SC(71)	125-0411-0 71	20	11.5	
HR25-9TR-20PC(71)	125-0412-2 71	20	13	

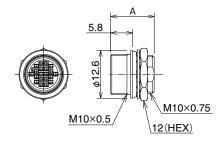

■ Receptacle





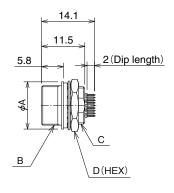

Direct PCB mounting type


Unit: mm

Part No.	HRS No.	No. of contacts	ϕ A	В	С	D	Weight
HR25-7TR-4SA(73)	125-0019-3 73	4					
HR25-7TR-4PA(73)	125-0020-2 73	4					
HR25-7TR-6SA(73)	125-0021-5 73	6	10.6	M8.5×0.5	M8×0.5	10	20
HR25-7TR-6PA(73)	125-0022-8 73	0	10.0	IVIO.3XU.3	IVIOXU.5	10	3g
HR25-7TR-8SA(73)	125-0023-0 73	8					
HR25-7TR-8PA(73)	125-0024-3 73	0					
HR25-9TR-12SA(71)	125-0119-8 71	12					
HR25-9TR-12PA(71)	125-0120-7 71	12					
HR25-9TR-16SA(71)	125-0121-0 71	16	12.6	M10.5×0.5	M10×0.75	12	4~
HR25-9TR-16PA(71)	125-0122-2 71	10	12.0	W110.5X0.5	W10x0.75	12	4g
HR25-9TR-20SA(71)	125-0123-5 71	20					
HR25-9TR-20PA(71)	125-0124-8 71	20					

Jack





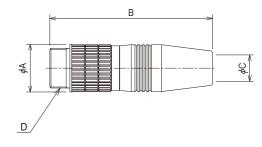

Solder type

Unit: mm

• • • • • • • • • • • • • • • • • • • •							
Part No.	HRS No.	No. of contacts	ϕ A	В	ϕ C	D	Weight
HR25-7TJ-4S(72)	125-0013-7 72	4					
HR25-7TJ-4P(72)	125-0014-0 72	4					
HR25-7TJ-6S(72)	125-0015-2 72	6	10.6	35	5	M8.5×0.5	0
HR25-7TJ-6P(72)	125-0016-5 72	0	10.6	35			8g
HR25-7TJ-8S(72)	125-0017-8 72	8					
HR25-7TJ-8P(72)	125-0018-0 72	0					
HR25-9TJ-12S(72)	125-0113-1 72	12					
HR25-9TJ-12P(72)	125-0114-4 72	12					
HR25-9TJ-16S(72)	125-0115-7 72	16	12.6	43	7	M10.5×0.5	10-
HR25-9TJ-16P(72)	125-0116-0 72	10	12.0	43	/		12g
HR25-9TJ-20S(73)	125-0117-2 73	20					
HR25-9TJ-20P(72)	125-0118-5 72	20					


Crimp type

Unit: mm

• • · · · · · · · · · · · · · · · · · ·							
Part No.	HRS No.	No. of contacts	φA	В	φC	D	Weight
HR25-9TJ-12SC(72)	125-0413-5 72	12					
HR25-9TJ-12PC(72)	125-0414-8 72	12					
HR25-9TJ-16SC(72)	125-0415-0 72	16	12.6	43	7	M10.5×0.5	100
HR25-9TJ-16PC(72)	125-0416-3 72	10	12.0	43	/	WITU.5XU.5	12g
HR25-9TJ-20SC(72)	125-0417-6 72	20					
HB25-9TJ-20PC(72)	125-0418-9 72	20					

■Crimp-style contacts

Male Contacts

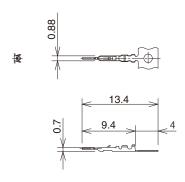


Туре	Part No.	HRS No.	Suitable Wire	
Loose	HB25-PC-111	125-0419-1		
contacts	11112010111	120 0410 1	AWG#30	
Reel	HB25-PC-211	125-0420-0	AVVG#30	
contacts	HH25-FG-211	125-0420-0		

Note: 1. Please use wire with a outer jacket diameter of 0.71mm or less

2. Loose contacts come in packages of 100 pcs. Reel contacts come in reels of 10,000 pcs.

Female Contacts

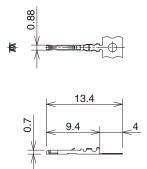

Type	Type Part No.		Suitable Wire	
Loose	HR25-SC-111	125-0421-3		
contacts	111123 30 111	123 0421 3	AWG#30	
Reel	HR25-SC-211	125-0422-6	AVVG#30	
contacts	HD25-30-211	123-0422-6		

Note: 1. Please use wire with a outer jacket diameter of 0.71mm or less

2. Loose contacts come in packages of 100 pcs. Reel contacts come in reels of 10,000 pcs.

♠ Applicable Tools

Туре	Item	Part No.	HRS No.	Applicable Contacts	Applicable Wire and Applicable Cable Diameter
Manual	Manual crimping tool	HR25-TA3032HC	150-0207-3	HR25-PC-111 HR25-SC-111	AWG#30
Auto	Auto crimping machine body	CM-105C	901-0001-0	-	-
	Applicator	AP105-HR25-1	901-2040-6	HR25-PC-211 HR25-SC-211	AWG#30
Cable crimping tool		HR10A-TC-02	150-0041-2	_	φ5、φ7
Extractor		HR25-TP	150-0091-0	-	-

Assembly Tools

Use of the following assembly tools will simplify the process of disassembling and assembling the connectors for the cable assembly.

Part No.	HRS No.	Suitable Connectors and Uses
HR25-7TP-T01	150-0082-0	For HR25-7TP wiring and P shell unit tightening
HR25-9TP-T01	150-0080-4	For HR25-9TP wiring and P shell unit tightening
HR25-7TJ-T01	150-0089-9	For HR25-7TJ wiring and J shell unit tightening
HR25-9TJ-T01	150-0090-8	For HR25-9TJ wiring and J shell unit tightening

● Cable Assembly Procedures

O The outline of wiring work for this diagram uses the soldered type as an example.

The jack side is also based on the work outline of the plug: however, the receptacle side does not require a special work outline and has been omitted because of this.

Construction Diagram

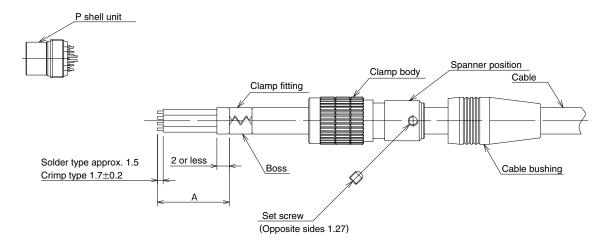


Table 1

Shell size	Soldered type A dimensions	Crimp type A dimensions	Spanner spacing	Tightening torque
7	10mm	_	8mm	1N • m
9	19mm	15mm	10mm	1N • m

Work Operation Procedures


- 1. With regard to cables, the wire to be used should have a conductor with a nominal cross-sectional area of 0.08 mm² (AWG#28) or less in a finished form suited to each size.
- 2. First pass the cable bushing and the plug body in order over the cable, then cut the end at the dimensions indicated in the above diagram.
- 3. Mount the P shell unit in the wiring jig and perform the solder wiring.
- 4. Use the cable crimping jig (HR10A-TC-02) to fix the clamp fitting to the cable.
- 5. After performing the wiring, tighten the plug body to the screw part of the P shell unit using the specified torque (in the above table).
- 6. Tighten the set screw so that the tip of the set screw falls into one of the two bosses of the clamp fitting. Note that the tightening torque of the set screw is from 0.3 to 0.4 Nm.
- 7. Put the cable bushing over the plug body and complete the work.
 In addition, apply Loctite 263 which is manufactured by Henkel Japan Ltd., Tokyo to the screw part of the P shell unit in order to prevent looseness.

The aforementioned work procedure is for the soldered type. In the case of the crimp-style type, Steps 1 and 3 are changed as follows:

- 1. With regard to cables, the wire to be used should have a conductor with a nominal cross-sectional area of 0.05 mm² (AWG#30) in a finished form suited to each size.
- 3. Crimp a suitable crimp terminal to the conductor part of the cable, then fit into the housing of the P shell unit.


● Mounting Hole Dimensions Diagram

Mounting hole dimensions are indicated as viewed from the engagement side.




Lock System	Screw Lock Type		
Shell Size Diagram Symbol	Size 7	Size 9	
Α	1.55 +0.05	1.55 +0.05	
В	$7.25^{+0.03}_{-0.02}$	$9.25 ^{+0.03}_{-0.02}$	
С	4.4 $^{+0.1}_{0}$	5.4 ^{+0.1}	
D	8 +0.05	10 +0.05	
Mounting Panel Thickness	0.7 ~ 2	0.7 ~ 2	


Note: The ∇ mark indicates the engagement guide key position.

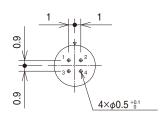


Size 7, 4 conductors

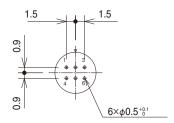



Size 7, 6 conductors




Size 7, 8 conductors

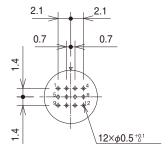



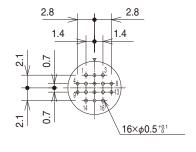

Size 9, 16 conductors

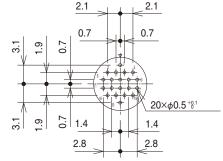

Size 9, 20 conductors

Note:

- 1. The above diagrams are viewed from the engagement side of the socket insert (i.e., the wiring side of the pin insert).
- 2. The ∇ mark of the above diagrams indicates the engagement guide key position.
- 3. A tolerance of ± 0.05 is recommended for dimensions without indication.

● Contact Configuration and Basic Specifications

Shell size	Size 7			
Contact configuration	(1) (2) (3) (4)	① ② ③ ④ ⑤ ⑥	(1) (2) (3) (4) (5) (6) (7) (8)	
Number of contacts	4	6	8	
Withstand voltage	100V AC for 1 minute			
Current capacity 1A				
Insulation resistance	1,000MΩ or greater			
Contact resistance	30mΩ			
Solder pot inside diameter	U 5mm dia			

Shell size	Size 9			
Contact configuration	① ② ③ ④ ⑤ ⑥ ⑦ ⑧ ⑨ ⑪ ⑪ ⑫	1 2 3 4 5 6 7 8 9 10 11 2 13 14 15 16	\(\frac{\frac}\frac{\fir}{\fir}}}}}}}{\frac{\frac{\frac{\frac{\fir}{\firighta}}}}}{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{	
Number of contacts	12	16	20	
Withstand voltage	100V AC for 1 minute			
Current capacity	1A			
Insulation resistance	1,000MΩ or greater			
Contact resistance	30mΩ			
Solder pot inside diameter	0.5mm dia.			

Note:

- 1. The above diagrams are viewed from the engagement side of the socket insert (i.e., the wiring side of the pin insert).
- 2. The ∇ mark of the above diagrams indicates the engagement guide key position.
- 3. The withstand voltage indicates the test voltage value. For regular use the voltage used should be less than 30 V AC or 42 V DC.
- 4. The current capacity of the crimp terminals indicates the value when using wire of AWG#30.
- 5. The insulation resistance indicates a value when measured at 100 V DC.

Precautions

- 1. Switch off the power of the circuit before disconnecting or plugging-in the connectors.
- 2. Use connectors with socket contacts at the power side of the circuit.
- 3. Make sure that the coupling is in completely cocked position.
- 4. Cable clamping, cable rotation, and other forces may vary with the cable construction. Please make sure that your cable is suitable for use with these connectors before usage and production.
- 5. For plug and jack, screw part of shell has an anti-looseness coating (Mec process), but the adhesive function is impaired when they are reused. Therefore, apply Loctite 263 which is manufactured by Henkel Japan Ltd., Tokyo to the screw part during reassembly in order to prevent looseness.

HIROSE ELECTRIC CO.,LTD.

2-6-3,Nakagawa Chuoh,Tsuzuki-Ku,Yokohama-Shi 224-8540,JAPAN https://www.hirose.com/